

DAILY FIELD OBSERVATION REPORT

GPCEI Project No: 1636.55

Report Date: April 19, 2017

Visit Date: April 19, 2017

Temp. Range: 39-46°F

Project: Birch Lane Drainage Improvements

Client: Town of Cumberland

GP Field Rep: Ben Grondin (BG), Asher J. Anderson (AJA)

Weather: Clear

Time onsite: 7:00 am - 8:15 am (BG), 8:15 am - 10:30 am (A|A)

Glidden Excavation and Paving:

Personnel – I - Foreman, 7- Laborers

Equipment -I - Skid Steer, I - Curb Machine, I - Truck

Distribution: File, Bill Shane, Chris Bolduc

Work in Progress

> Glidden Paving crew installed base pavement around structures and installed curb.

Discussions/Observation

- ▶ 8:15 am AJA arrived on site. Crew had installed base pavement around structures and was preparing to install curb. Tack coat had been applied to base pavement where curb was to be placed.
- > 8:20 am Curb installation began. Crew was attempting to use 9.5mm mix to construct curb.
- > 8:30 am AJA directed the crew to install tip downs on each side of the curb break placed to catch a roof drain outlet.
- > 8:40 am AJA directed the foreman to arc curb around the catch basin on the north side of the street. Curb had been notched out at the catch basin on the south side of the street.
- ▶ 8:45 am AJA noted an outlet pipe in the lawn area of the house on the uphill side of the work on the south side of the street. When curb is backed up the area near the outlet should be graded to move water away from the curb.
- > 8:50 am Crew ran out of mix. Delay while additional mix was retrieved.
- > 9:30 am Additional mix arrived on site. Curb installation resumed.
- > 9:45 am Crew attempted to install curb on the north side of the street. Mix was not filling the mold, crew abandoned installing curb on the north side of the street.
- > 9:55 am Bob and AJA reviewed the curb installed on the southern side of the street. Bob offered to remove the curb and replace with appropriate mix on another day.
- ➤ 10:00 am Crew removed curb.
- ➤ 10:30 am A|A left the site.

Schedule of Work

Curb installation date TBD.

Prepared By: <u>Asher J. Anderson</u>
Reviewed By: Doug Reynolds, PE


If there are any discrepancies, please notify the sender immediately



Curb installation on Birch Lane



Paved swale to catch roof drain on the south side of the street.

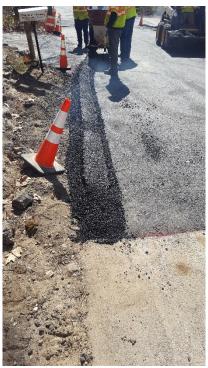

Curb installation attempt on the north side of the street.



Unsatisfactory curb removal on the south side of the street.